


DEFICIENCY:
PARTIALLY
DELAMINATED SEAM.

DEFICIENT SEAM – 3D VIEW

A

USE MASTIC TO SET THE
MEMBRANE AND PRESS
DOWN


X-Tenda Coat PRIMER
AS REQUIRED. REFER
TO SPECS.

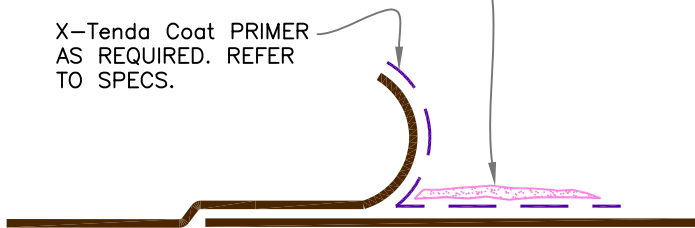

REPAIR STEP 1

X-Tenda Coat PRIMER
AS REQUIRED. REFER
TO SPECS.

MASTIC

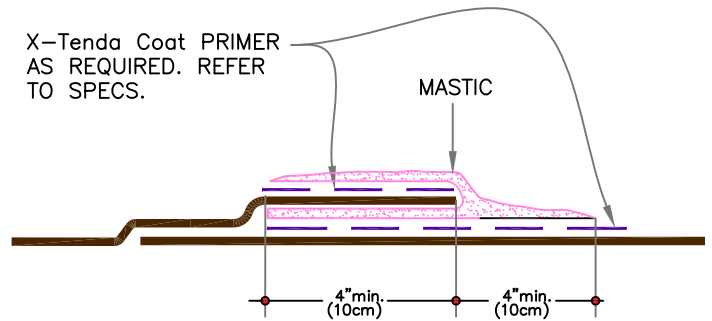

REPAIR STEP 2

B

C



REPAIR:
SEAM PARTIALLY DELAMINATED

X-Tenda Coat

- X-Tenda Coat COATING
- X-Tenda Coat PRIMER
- REINFORCEMENT
- X-Tenda Coat MASTIC
- 0 NOTE(S)

NEW COATING ON EXISTING LOW SLOPE ROOFS

For additional information, refer to Specifications

A-5