



- WOOD NAILERS ARE INSTALLED ONLY AT SCUPPERS TO SECURE METAL SLEEVE AND MUST EXTEND PAST THE WIDTH OF METAL SLEEVE FLANGE.
- 2. INSTALL WALL FLASHING PRIOR TO SCUPPER INSTALLATION.
- 3. METAL SCUPPER BOX MUST HAVE CONTINUOUS FLANGES WITH ROUNDED CORNERS. SOLDER ALL SCUPPER SEAMS WATER—TIGHT.
- 4. WATER CUT-OFF MASTIC UNDER SCUPPER FLANGE MUST BE UNDER CONSTANT COMPRESSION.
- 5. SCUPPER FLANGES MUST BE TOTALLY COVERED BY THERMOPLASTIC NON-REINFORCED FLASHING WITH MINIMUM 2" (5cm) COVERAGE PAST NAIL HEADS.
- 6. UNIVERSAL SINGLE—PLY SEALANT IS REQUIRED AT FLASHING EDGES ON SCUPPER EDGE. WHEN USING THERMOPLASTIC FLASHING, THERMOPLASTIC PRIMER MUST BE USED TO PREPARE SURFACES PRIOR TO THE APPLICATION OF SEALANT.



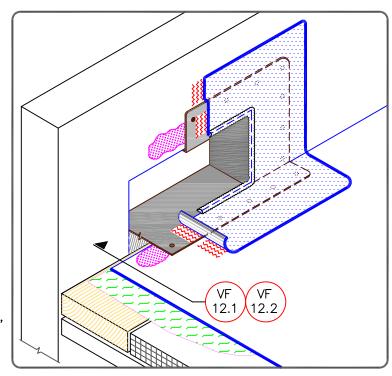

THROUGH-WALL SCUPPER WITH THERMOPLASTIC COATED METAL

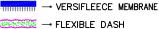

→ APPROVED SUBSTRATE

→ SEE NOTE(S)

0

THERMOPLASTIC VERSIFLEECE ADHERED

VF-18.2A